


# 1000 series

Toggle switches - metal lever - economy range

*Distinctive features and specifications*

UG1006-A

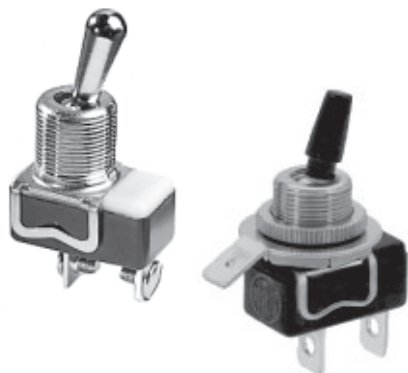

- ☐ Butt action contacts
- ☐ Optional insulated levers (X213 and X490)

## ELECTRICAL SPECIFICATIONS

- Max. current/voltage rating with resistive load :
  - silver contacts (A) : 3A 250VAC - 6A 125VAC - 6A 30VDC
  - silver plated copper contacts (C) : 2A 250VAC
- Initial contact resistance : 10 mΩ max.
- Insulation resistance : 1.000 MΩ min. at 500VDC
- Dielectric strength :
  - 2.000 Vrms 50 Hz min. between terminals
  - 2.500 Vrms 50 Hz min. between terminals and frame
- Electrical life : 10.000 cycles at full load

## MATERIALS

- Case :
  - function 1 : phenolic resin
  - funct. 6 & 9 : polyamide
- Actuator :
  - brass, nickel plated (1010 and 1020 models)
  - polyamide (1030 models)
- Bushing : brass, nickel plated
- Contacts :
  - A : silver
  - C : copper, silver plated

## GENERAL SPECIFICATIONS

- Torque : 1,50 Nm (1.10 Ft.lb) max. applied to nut
- Panel thickness : 5 mm (.196) max.
- Operating temperature : -20°C to +55°C

## ABOUT THIS SERIES

**Dimensions** : first dimensions are in mm while inches are shown as bracketted numbers.



**Sealing boots** are available to protect the switches against dust and water. They are presented in section H.



**Mounting accessories** : standard hardware supplied :

- silver contact models : 1 hex nut U166 + 1 knurled nut U411
- copper contact models : 1 hex nut U42 + 1 knurled nut U411



**Packaging unit** : 25 or 40 pieces depending on model.


# 1000 series

Toggle switches - metal lever - economy range



Solder lug and quick-connect terminals - screw terminals

MODEL  
STRUCTURE

→ Keyway

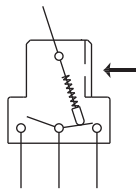

- 2 and 3 positions
- Single pole configurations

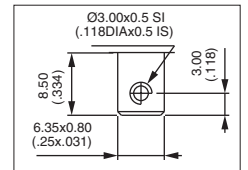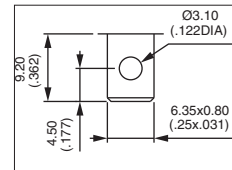

MODEL  
STRUCTURE






## Solder lug and quick-connect terminals



1011  
1016  
1019

| I  | II  | III |
|----|-----|-----|
| ON | -   | OFF |
| ON | -   | ON  |
| ON | OFF | ON  |

→ Keyway

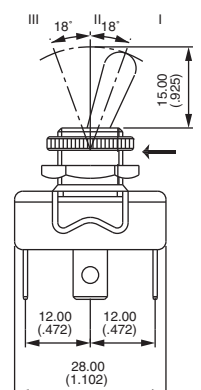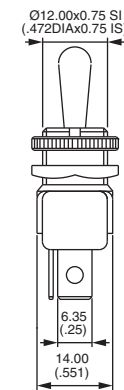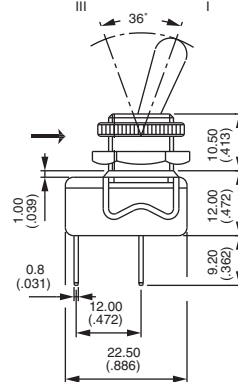



## Screw terminals




1021

| I  | II | III |
|----|----|-----|
| ON | -  | OFF |

→ Keyway

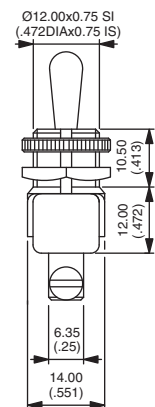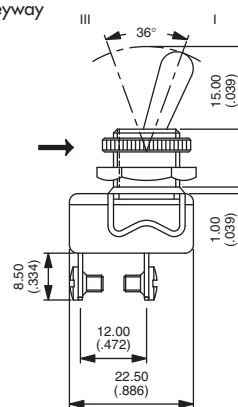


## PANEL CUT-OUT


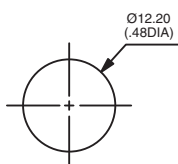




### Solder lug and quick-connect terminals - screw terminals



I                      III  
OFF       -       ON

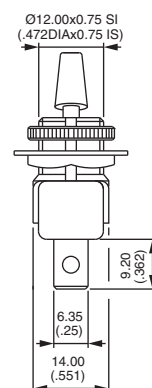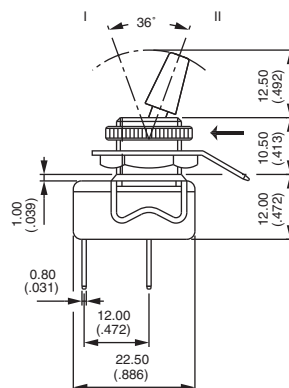

| I  | II  | III |
|----|-----|-----|
| ON | -   | ON  |
| ON | OFF | ON  |

